



HIGH PRECISION DIGITAL HEIGHT GAGES




power supplied by charge pal

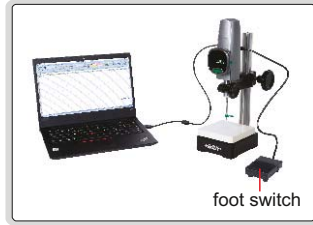

data transmitted to Excel without software;
short press the foot switch to transmit data,
long press to zero

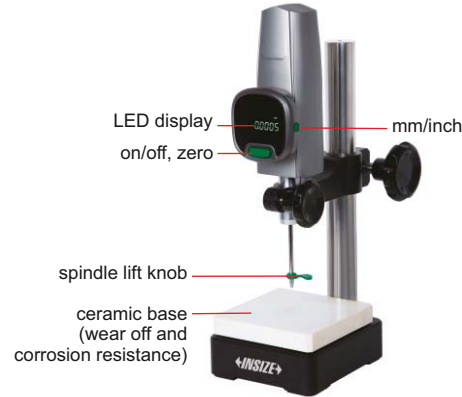

1155-505

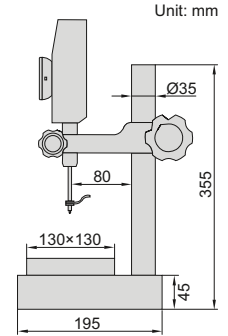

- High stability, high precision, high response speed (5000mm/s)
- High brightness LED display
- Ceramic base flatness: 1 μ m

Code	Range	Resolution	Accuracy (20°C)	Measuring force	Output	Power supply
1155-505	0~50mm	0.5 μ m/0.00002" (can switch to: 1 μ m/0.00005")	1.5 μ m	1.0~1.5N	USB	5V/1A (adapter or charge pal)
1155-510	0~50mm	0.1 μ m/0.000005" (can switch to: 1 μ m/0.00005")	1 μ m	1.0~1.5N	USB	5V/1A (adapter or charge pal)

STANDARD DELIVERY

Main unit	1 pc
-----------	------

OPTIONAL ACCESSORY

Contact point	code 6282
Charge pal	1155-5-POB
Data output cables (including foot switch)	1155-5-FOS